# wictolouic



## Operating manual

hps+ Ultrasonic Sensors for application in overpressure with two switching outputs

hps+25/DD/TC/E/G1 hps+35/DD/TC/E/G1 hps+130/DD/TC/E/G1 hps+340/DD/TC/E/G2 hps+340/DD/TC/G2

#### **Product description**

- The hps+ sensor measures the level in a vessel in up to 6 bar overpressure contactless. The G1 and G2 threaded pipe end permits the mounting and sealing of the sensor in a flange of the vessel. The pnp switching outputs are set according to the adjusted detect distances.
- The surfaces of the ultrasonic transducers of the hps+ sensors are protected by a PTFE film and sealed with a FFKM O-ring against the sensor housing. Therefore the surface of the ultrasonic transducer can be cleaned from cakings or spots.
- All settings are done with two push-buttons and a three-digit LED display (Touch-
- Light emitting diodes (three-colour LEDs) indicate all operation conditions.
- The output functions are changeable from NOC to NCC.
- The sensors are adjustable manually using the numerical LED display or may be trained via Teach-in processes.
- Useful additional functions are set in the Add-on-menu.
- Using the LinkControl adapter (optional accessory) all TouchControl and additional sensor parameter settings may be made by a Windows software.

### Important instructions for assembly and application

All employee and plant safety-relevant measures must be taken prior to assembly, start-up or maintenance work (see operating manual for the entire plant and the operator instruction of the plant).

## The sensors are not considered as safety equipment and may not be used to ensure human or machine safety!

The hps+ sensors indicate a blind zone, in which the distance cannot be measured. The operating range indicates the distance of the sensor that can be applied in normal atmospheric pressure with sufficient function re-

#### Assembly instructions

- Assemble the sensor at the installation lo-
- ▶ If necessary seal the sensor with the enclosed Viton O-ring (34 x 2,5 mm or 60 x 4 mm) against the flange.
- ▶ Plug in the connector cable to the M12 connector.




Fig. 1: Pin assignment with view onto sensor plug and colour coding of the

#### Start-up

hps+ sensors are delivered factory made with the following settings:

- Detecting distances at operating range

- Measurement range set to maximum
  - range at  $\geq$  2 bar overpressure.
  - Sensitivity at normal pressure.

Set the parameters of the sensor manually or use the Teach-in procedure to adjust the detect points.




Fig. 2: TouchControl

### Maintenance

hps+ sensors work maintenance free. Small amounts of dirt on the surface do not influence function. Thick lavers of dirt and cakedon dirt affect the sensor function and therefore must be removed.


■ In operation in overpressure it is recommended to adjust the sensitivity of the hps+ sensor: choose the parameter A14 in the Add-on menu and set it to sensitivity E2 for atmospheric pressure from 1 to 3 bar or to sensitivity E3 for atmospheric pressure > 3 bar.

AbN

- hps+ sensors have internal temperature compensation. Because the sensors heat up on their own, the temperature compensation reaches its optimum working point after approx. 30 minutes of opera-
- During normal operating mode, a vellow LED signals that the corresponding switching output is set.
- During normal operating mode, the measured distance value is displayed on the LED display in mm (up to 999 mm) or cm (from 100 cm). Scale switches automatically and is indicated by a point on top of the diaits.
- During Teach-in mode, the hysteresis value is set back to factory settings.
- If no objects are placed within the detection zone the LED display shows »- - -«.
- If no push-buttons are pressed for 20 seconds during parameter setting mode, the parameter changes are saved and the sensor returns to normal operating mode.


#### **Show parameters**


Tapping push-button T1 shortly during normal operating mode shows »PAr« on the LED display. Each time you tap push-button T1 the actual settings of the switching outputs are displayed.




microsonic connection cable

- Switching outputs on NOC.
- and half operating range.

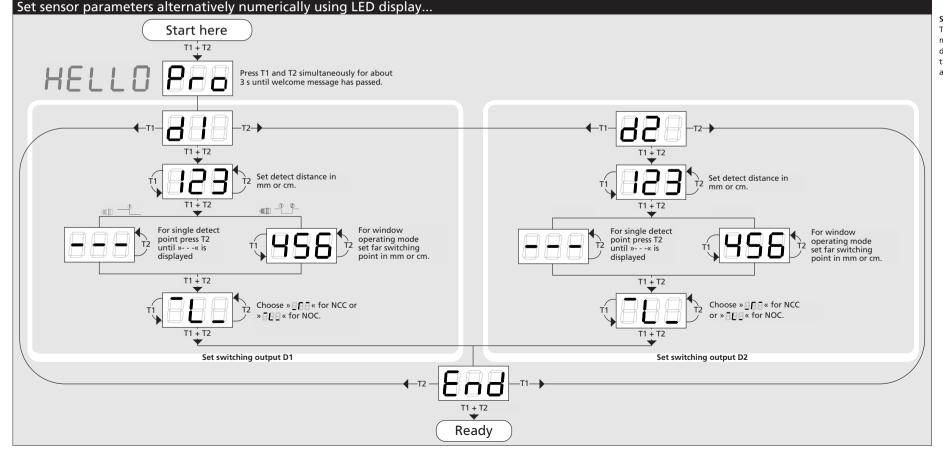

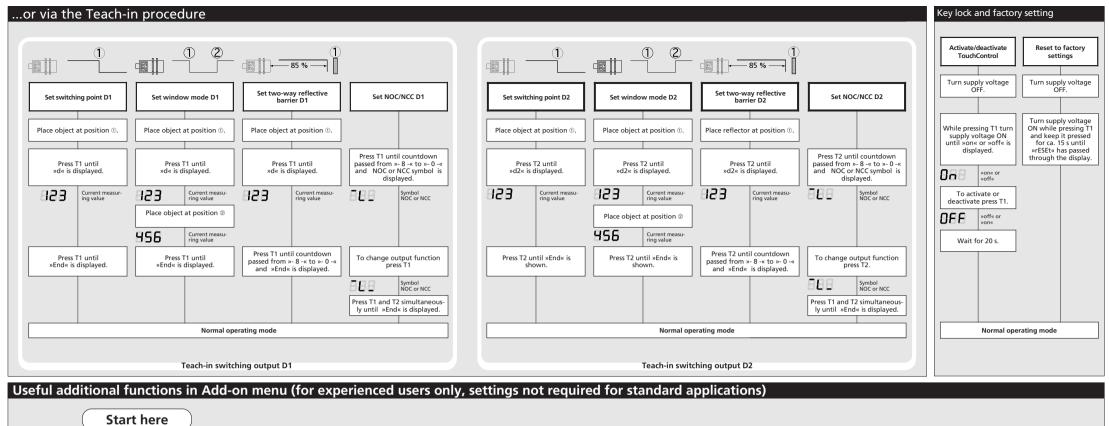

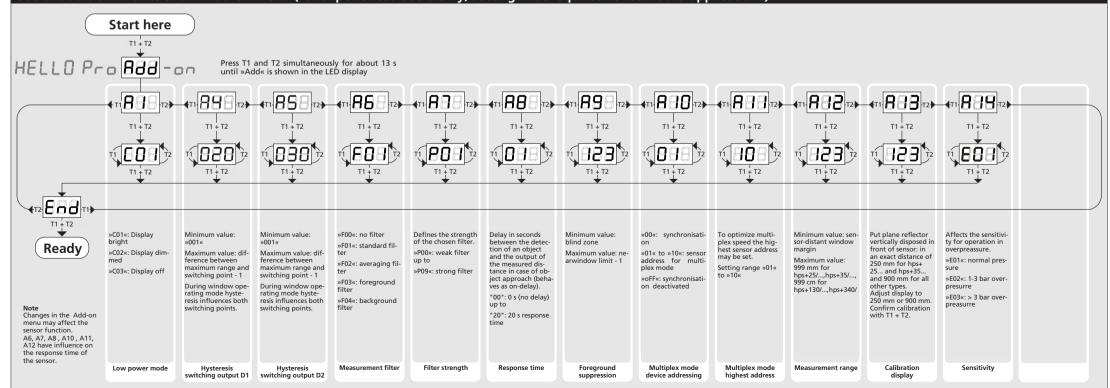

AbN Technical data automation D.1111111 hps+340... hps+25... hps+35... hps+130... 41 width A/F 41 width A/F 41 width A/F TouchControl LED-Display 2 Buttons TouchControl LED-Display 2 Buttons TouchControl LED-Display 2 Buttons TouchControl TouchControl Viton O-Ring (34 x 2,5) Viton O-Ring (34 x 2,5) Viton O-Ring (34 x 2,5) LED-Display 2 Buttons 2 Duo-LED LED-Display 2 Buttons 2 Duo-LED M30x1.5 M30x1.5 2 Duo-LED 2 Duo-LED 2 Duo-LED D1 D2 Svnc/Com 15 -15 -2 pnp switching outputs 103,5 103.5 blind zone 0 to 30 mm 0 to 85 mm 0 to 200 mm 0 to 350 mm 0 to 350 mm operating range 250 mm 350 mm 1 300 mm 3 400 mm 3 400 mm maximum range at normal pressure 350 mm 600 mm 2.000 mm 5,000 mm 5,000 mm maximum range at ≥ 2 bar overpressure 1.500 mm 5.000 mm 8.000 mm 8.000 mm 990 mm angle of beam spread Please see detection zone transducer frequency 320 kHz 320 kHz 180 kHz 120 kHz 120 kHz resolution 0.025 mm 0.18 mm 0.18 mm 0.18 mm 0.18 mm reproducibility ± 0.15 % ± 0.15 % ± 0.15 % ± 0.15 % ± 0.15 % ± 1 % (temperature drift internally compensated) ± 1 % (temperature drift internally compensated) ± 1 % (temperature drift internally compensated) accuracy ± 1 % (temperature drift internally compensated) ± 1 % (temperature drift internally compensated) Detection zones for different objects: The dark grey areas are determined ĺΩm with a thin round bar and indicate the typical operating range of a sensor. In order to obtain the light grey areas, a plate (500 x 500 mm) is introduced 10 cm into the beam spread from the side 0 4 n In doing so, the optimum angle between plate and sensor is always employed. This therefore indicates the maximum 20 cm Round bar ø 27 mm detection zone of the sensor It is not possible to evaluate ultrasonic reflections outside this area. 15 cm 30 cm Displayed is the detection zone at standard pressure. 35 cm At 1 bar overpressure the sensitivity of the sensor 1.2 m 1.3 m will increase 5 times. 3 4 m 3 4 m 4 0 m 25 cm 1.6 m 4 0 m 50 cm 30 cm 2 0 m 35 cm 9 V to 30 V DC, short-circuit-proof 9 V to 30 V DC, short-circuit-proof operating voltage U<sub>B</sub> 9 V to 30 V DC, short-circuit-proof 9 V to 30 V DC, short-circuit-proof 9 V to 30 V DC, short-circuit-proof voltage ripple ±10 % ±10 % ±10 % ±10 % ±10 % ≤ 80 mA no-load supply current up to 6.0 bar ambient pressure Stainless steel 1.4571, plastic parts: PBT, TPU; Plastic parts: PVDF, PBT, TPU; Ultrasonic transducer: PTFE film, FFKM O-ring process connection G1 G2 G1 G1 G2 class of protection to EN 60529 IP 67 IP 67 IP 67 IP 67 IP 67 norm conformity EN 60947-5-2 EN 60947-5-2 EN 60947-5-2 EN 60947-5-2 EN 60947-5-2 type of connection 5-pin initiator plug, PBT 2 push-buttons (TouchControl) controls indicators 3-digit LED display, 2 three-colour LEDs programmable TouchControl and LinkControl operating temperature -25°C to +70°C storage temperature -40°C to +85°C 210 g 210 g 1,200 g 350 g weight 210 g switching hysteresis1) 3 mm 5 mm 20 mm 50 mm 50 mm switching frequency2) 11 Hz 9 Hz 5 Hz 3 Hz 3 Hz response time2) 68 ms 84 ms 160 ms 240 ms 240 ms time delay before availability < 300 ms < 300 ms < 300 ms < 380 ms < 380 ms hps+130/DD/TC/F/G1 hns+340/DD/TC/E/G2 hns+340/DD/TC/G2 order no. hns+25/DD/TC/E/G1 hns+35/DD/TC/F/G1 2 x pnp, U<sub>B</sub>-2 V, I<sub>max</sub> = 2 x 200 mA 2 x pnp, U<sub>B</sub>-2 V, I<sub>max</sub> = 2 x 200 mA 2 x pnp, U<sub>B</sub>-2 V, I<sub>max</sub> = 2 x 200 mA 2 x pnp, U<sub>B</sub>-2 V, I<sub>max</sub> = 2 x 200 mA 2 x pnp, U<sub>B</sub>-2 V, I<sub>max</sub> = 2 x 200 mA switching outputs switchable NOC/NCC, short-circuit-proof 1) Can be programmed with TouchControl and LinkControl 2) With TouchControl and LinkControl, the selected filter setting and the maximum range influence the switching frequency and response time.





